

"Buying a home is your business...inspecting it is ours"

Inspection Report

Mrs. Home Owner Mr. Home Owner

Property Address: 123 Fernley Ct Fernley, NV 89408

123 Fernley Ct Page 1 of 33



123 Fernley Ct

Home Inspection Associates, LLC

Robert A. Parmenter III 3009 Beaverhead Ln Fernley, NV 89408 (775)247-8799



123 Fernley Ct Page 2 of 33

Summary



"Buying a home is your business...inspecting it is ours"

Home Inspection Associates, LLC

3009 Beaverhead Ln Fernley, NV 89408 (775)247-8799

Customer

Mrs. Home Owner Mr. Home Owner

Address

123 Fernley Ct Fernley, NV 89408

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.


1. Roof

General Summary

1.0 ROOF COVERINGS

The roof covering is being lifted up by the flashing at the front of home. This does not appear adequate. It should be properly repaired or replaced. I recommend repair as desired.

123 Fernley Ct Page 3 of 33

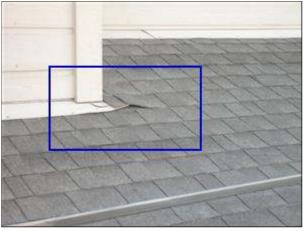

1.0 Picture 1

1.1 FLASHINGS


The flashing at the front edge of the home's roof has nail holes in it from a previous installation. Recommend seal holes.



1.1 Picture 1

1.3 ROOF DRAINAGE SYSTEMS (Gutters and Downspouts)

There is some evidence of water damage on the trim piece on the front of the home where the wall facing East meets the roofline. Repair as needed.

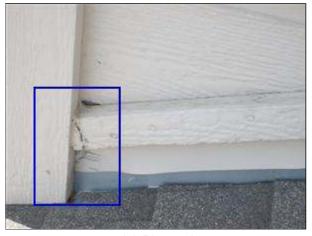

1.3 Picture 1


2. Exterior


General Summary

123 Fernley Ct Page 4 of 33


2.0 SIDING, FLASHING AND TRIM

The wood trim at the covered porch and back patio is in direct contact with concrete and is allowing water to be absorbed along the bottom edge. Further deterioration can occur if not corrected. A qualified person should repair or replace as needed.

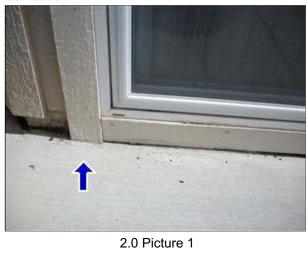

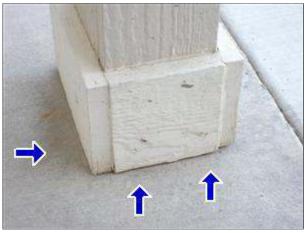

2.0 Picture 2

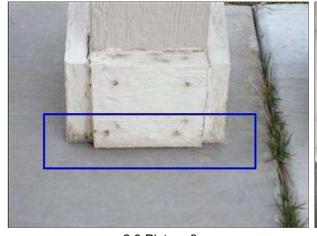



2.0 Picture 3

2.0 Picture 4

2.1 EAVES, SOFFITS AND FASCIAS

A gap between the two pieces of joined fascia exists which was caused by the boards twisting/warping. Only one nail is present. Repair to prevent further warping.



2.1 Picture 1

2.2 DOORS (Exterior)

123 Fernley Ct Page 5 of 33

The main entry door rubs at jamb when closing. This is a maintenance issue and is for your information. I recommend repair as desired.



2.2 Picture 1

2.3 WINDOWS

The window frames on the outside and inside in a few places have deteriorated sealant and could lead to water intrusion. Further deterioration may occur if not repaired. I recommend repair as desired.





2.3 Picture 1

2.3 Picture 2



2.3 Picture 3

123 Fernley Ct Page 6 of 33

2.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)

(1) The rose bushes are in contact with the wall under the back window. They should be trimmed to reduce the chances of insects finding their way into the home. This is for your information



2.5 Picture 1

(2) There is a drainage slope at the rear of the home. This area appears to drain water away from home but needs some fill and rocks to prevent further erosion. This if for your information.



2.5 Picture 2

3. Basement, Foundation, Crawlspace and Structure

General Summary

3.0 FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)

The foundation wall at the left side (facing front) is deteriorated. No repairs are needed or foreseen at this time. These typical cracks are likely of no concern.

123 Fernley Ct Page 7 of 33



3.0 Picture 1

4. Heating / Cooling

Heating Cooling / Summary

- 4.3 DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)
 - (1) The disposable filter for the heating and air conditioner in the upstairs hallway is a bit dirty. The filter likely needs to be replaced soon. I recommend repair or replace as needed.



4.3 Picture 1

(2) The exhaust fan cover in the master bath toilet area is dirty and needs cleaning.



4.3 Picture 2

123 Fernley Ct Page 8 of 33

8. Doors, Windows and Interior

General Summary

8.6 WINDOWS (REPRESENTATIVE NUMBER)

One window has deteriorated sealant in the Guest Bedroom. This is a maintenance issue and is for your information. I recommend prep prime and paint as needed.




8.6 Picture 1

9. Insulation and Ventilation

General Summary

9.2 VENTING SYSTEMS (Kitchens, baths and laundry)

(1) Dryer vent has gotten collapsed on the back side of dryer due to it being pushed back.

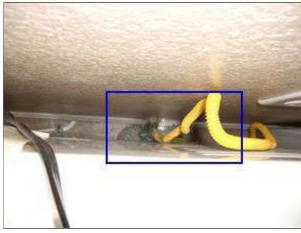

9.2 Picture 1

(2) Dryer vent on the outside of the home has build up of lint. This is a safety issue as a potential for fire exists if the dryer cannot vent properly.

123 Fernley Ct Page 9 of 33



9.2 Picture 2

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.homegauge.com SHGI (c) 2000-2007 : Licensed To Home Inspection Associates, LLC

123 Fernley Ct Page 10 of 33

Table of Contents

Cover Page	<u> 1</u>
Summary	<u> 3</u>
Table of Contents	<u>. 11</u>
<u>1 Roof</u>	<u>. 12</u>
2 Exterior	
3 Basement, Foundation, Crawlspace and Structure	<u>. 19</u>
4 Heating / Cooling	<u>. 20</u>
5 Plumbing System	
6 Electrical System	
7 Fireplace	
8 Doors, Windows and Interior	<u>. 25</u>
9 Insulation and Ventilation	
<u>10 Garage</u>	<u>. 29</u>
11 Built-In Kitchen Appliances	<u>. 30</u>
<u>Attachments</u>	<u>. 31</u>
Invoice	

123 Fernley Ct Page 11 of 33

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

Roof

The inspector shall inspect from ground level or eaves: The roof covering. The gutters. The downspouts. The vents, flashings, skylights, chimney and other roof penetrations. The general structure of the roof from the readily accessible panels, doors or stairs.

The inspector is not required to: Walk on any roof surface, predict the service life expectancy, inspect underground downspout diverter drainage pipes, remove snow, ice, debris or other conditions that prohibit the observation of the roof surfaces, inspect antennae, lightning arresters, or similar attachments.

1.0	ROOF COVERINGS			Х
1.1	FLASHINGS			Х
1.2	SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS	Χ		
1.3	ROOF DRAINAGE SYSTEMS (Gutters and Downspouts)			Х
1.4	ROOF STRUCTURE AND ATTIC	Χ		

IN NI NP RR

IN NI NP RR Styles & Materials

Roof Covering:

3-Tab fiberglass

Viewed roof covering from:

Ground

Walked roof

Sky Light(s):

None

Chimney (exterior):

N/A

Roof Structure:

Engineered wood trusses

Roof-Type:

Gable

Method used to observe attic:


Walked

Attic info:

Attic access


Comments:

1.0 The roof covering is being lifted up by the flashing at the front of home. This does not appear adequate. It should be properly repaired or replaced. I recommend repair as desired.

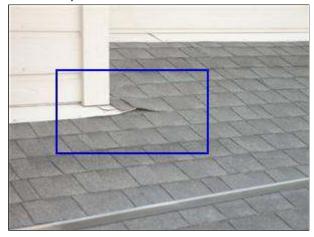


1.0 Picture 1

123 Fernley Ct Page 12 of 33 1.1 The flashing at the front edge of the home's roof has nail holes in it from a previous installation. Recommend seal holes.

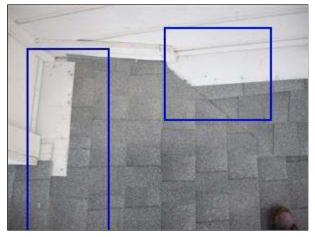

1.1 Picture 1

1.3 There is some evidence of water damage on the trim piece on the front of the home where the wall facing East meets the roofline. Repair as needed.

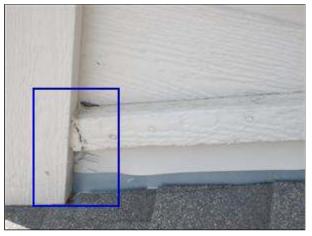

1.3 Picture 1

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 13 of 33

2. Exterior

The inspector shall inspect: The siding, flashing and trim. All exterior doors, decks, stoops, steps, stairs, porches, railings, eaves, soffits and fascias. And report as in need of repair any spacing between intermediate balusters, spindles, or rails for steps, stairways, balconies, and railings that permit the passage of an object greater than four inches in diameter. A representative number of windows. The vegetation, surface drainage and retaining walls when these are likely to adversely affect the structure. And describe the exterior wall covering.

The inspector is not required to: Inspect or operate screens, storm windows, shutters, awnings, fences, outbuildings, or exterior accent lighting, Inspect items, including window and door flashings, which are not visible or readily accessible from the ground, Inspect geological, geotechnical, hydrological and/or soil conditions, Inspect recreational facilities, Inspect seawalls, break-walls and docks, Inspect erosion control and earth stabilization measures, Inspect for safety type glass, Inspect underground utilities, Inspect underground items, Inspect wells or springs, Inspect solar systems, Inspect swimming pools or spas, Inspect septic systems or cesspools, Inspect playground equipment, Inspect sprinkler systems, Inspect drain fields or drywells, Determine the integrity of the thermal window seals or damaged glass.

		IN	NI	NP	RR	Styles & Materials
2.0	SIDING, FLASHING AND TRIM				Х	Siding Material: Wood
2.1	EAVES, SOFFITS AND FASCIAS				Х	Exterior Entry Doors:
2.2	DOORS (Exterior)				Х	Wood
2.3	WINDOWS				Х	Steel
2.4	DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS	Х				Appurtenance: Porch
2.5	VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)				Х	Sidewalk Patio Driveway:
2.6	OTHER	Х				Concrete


IN NI NP RR

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

Comments:

123 Fernley Ct Page 14 of 33

2.0 The wood trim at the covered porch and back patio is in direct contact with concrete and is allowing water to be absorbed along the bottom edge. Further deterioration can occur if not corrected. A qualified person should repair or replace as needed.

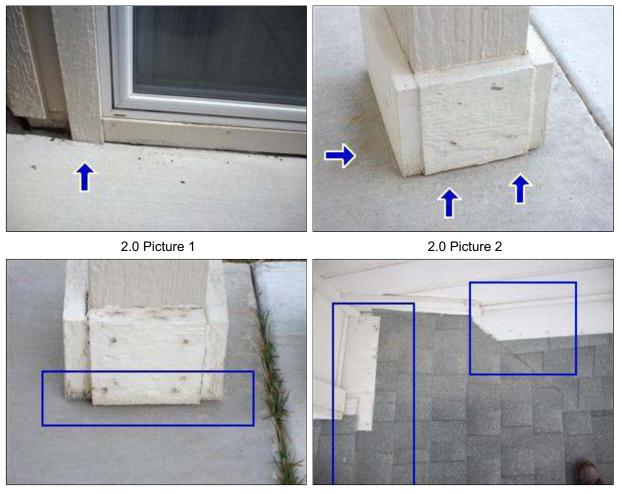

2.0 Picture 3 2.0 Picture 4

2.1 A gap between the two pieces of joined fascia exists which was caused by the boards twisting/warping. Only one nail is present. Repair to prevent further warping.



2.1 Picture 1

123 Fernley Ct Page 15 of 33

2.2 The main entry door rubs at jamb when closing. This is a maintenance issue and is for your information. I recommend repair as desired.



2.2 Picture 1

123 Fernley Ct Page 16 of 33

2.3 The window frames on the outside and inside in a few places have deteriorated sealant and could lead to water intrusion. Further deterioration may occur if not repaired. I recommend repair as desired.



2.3 Picture 1

2.3 Picture 2



2.3 Picture 3

2.5 (1) The rose bushes are in contact with the wall under the back window. They should be trimmed to reduce the chances of insects finding their way into the home. This is for your information



2.5 Picture 1

123 Fernley Ct Page 17 of 33

(2) There is a drainage slope at the rear of the home. This area appears to drain water away from home but needs some fill and rocks to prevent further erosion. This if for your information.



2.5 Picture 2

2.6 This fence is temporary in nature. This if for your information.



2.6 Picture 1

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 18 of 33

3. Basement, Foundation, Crawlspace and Structure

The inspector shall inspect: The basement. The foundation. The crawlspace. The visible structural components. Any present conditions or clear indications of active water penetration observed by the inspector. And report any general indications of foundation movement that are observed by the inspector, such as but not limited to sheetrock cracks, brick cracks, out-of-square door frames or floor slopes.

The inspector is not required to: Enter any crawlspaces that are not readily accessible or where entry could cause damage or pose a hazard to the inspector, Move stored items or debris, Operate sump pumps with inaccessible floats, Identify size, spacing, span, location or determine adequacy of foundation bolting, bracing, joists, joist spans or support systems, Provide any engineering or architectural service, Report on the adequacy of any structural system or component.


		114	141	IAL	1717	ory los a materials
3.0	FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)	Х				Foundation: Poured concrete Method used to observe
3.1	WALLS (Structural)	Х				Crawlspace: No crawlspace
3.2	COLUMNS OR PIERS	Х				Floor Structure:
3.3	FLOORS (Structural)	Х				Slab
3.4	CEILINGS (structural)	Х				Wall Structure:
		IN	NI	NP	RR	Wood

IN NI NP RR Styles & Materials

 $\label{eq:loss_ent_norm} \mbox{IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace}$

Comments:

3.0 The foundation wall at the left side (facing front) is deteriorated. No repairs are needed or foreseen at this time. These typical cracks are likely of no concern.

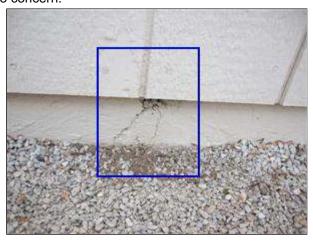

3.0 Picture 1

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 19 of 33

4. Heating / Cooling

The inspector shall inspect: The heating system and describe the energy source and heating method using normal operating controls. And report as in need of repair electric furnaces which do not operate. And report if inspector deemed the furnace inaccessible. The central cooling equipment using normal operating controls.

The inspector is not required to: Inspect or evaluate interiors of flues or chimneys, fire chambers, heat exchangers, humidifiers, dehumidifiers, electronic air filters, solar heating systems, solar heating systems or fuel tanks. Inspect underground fuel tanks. Determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the heating system. Light or ignite pilot flames. Activate heating, heat pump systems, or other heating systems when ambient temperatures or when other circumstances are not conducive to safe operation or may damage the equipment. Override electronic thermostats. Evaluate fuel quality. Verify thermostat calibration, heat anticipation or automatic setbacks, timers, programs or clocks. Determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the cooling system. Inspect window units, through-wall units, or electronic air filters. Operate equipment or systems if exterior temperature is below 60 degrees Fahrenheit or when other circumstances are not conducive to safe operation or may damage the equipment. Inspect or determine thermostat calibration, heat anticipation or automatic setbacks or clocks. Examine electrical current, coolant fluids or gasses, or coolant leakage.

4.0	HEATING EQUIPMENT	Χ			
4.1	4.1 NORMAL OPERATING CONTROLS				
4.2	4.2 AUTOMATIC SAFETY CONTROLS				
4.3	4.3 DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)				
4.4	PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM	Χ			
4.5	CHIMNEYS, FLUES AND VENTS (for gas water heaters or heat systems)	Χ			
4.6	COOLING AND AIR HANDLER EQUIPMENT	Χ			
4.7	NORMAL OPERATING CONTROLS	Χ			
4.8	PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM	Χ			

Heat Type:

Forced Air

Energy Source:

Gas

IN NI NP RR Styles & Materials

Number of Heat Systems (excluding wood):

One

Ductwork:

Insulated

Filter Type:

Disposable

Cooling Equipment Type:

IN NI NP RR Air conditioner unit

All conditioner unit

Source:

Electricity

Central Air Manufacturer:

Cooling Equipment Energy

CARRIER

Number of AC Only Units:

One

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

Comments:

123 Fernley Ct Page 20 of 33

4.3 (1) The disposable filter for the heating and air conditioner in the upstairs hallway is a bit dirty. The filter likely needs to be replaced soon. I recommend repair or replace as needed.



4.3 Picture 1

(2) The exhaust fan cover in the master bath toilet area is dirty and needs cleaning.



4.3 Picture 2

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 21 of 33

5. Plumbing System

The inspector shall: Verify the presence of and identify the location of the main water shutoff valve. Inspect the water heating equipment, including combustion air, venting, connections, energy sources, seismic bracing, and verify the presence or absence of temperature-pressure relief valves and/or Watts 210 valves. Flush toilets. Run water in sinks, tubs, and showers. Inspect the interior water supply including all fixtures and faucets. Inspect the drain, waste and vent systems, including all fixtures. Describe any visible fuel storage systems. Inspect the drainage sump pumps testing sumps with accessible floats. Inspect and describe the water supply, drain, waste and main fuel shut-off valves, as well as the location of the water main and main fuel shut-off valves. Inspect and determine if the water supply is public or private. Inspect and report as in need of repair deficiencies in the water supply by viewing the functional flow in two fixtures operated simultaneously. Inspect and report as in need of repair deficiencies in installation and identification of hot and cold faucets. Inspect and report as in need of repair mechanical drain-stops that are missing or do not operate if installed in sinks, lavatories and tubs. Inspect and report as in need of repair commodes that have cracks in the ceramic material, are improperly mounted on the floor, leak, or have tank components which do not operate.

The inspector is not required to: Light or ignite pilot flames. Determine the size, temperature, age, life expectancy or adequacy of the water heater. Inspect interiors of flues or chimneys, water softening or filtering systems, well pumps or tanks, safety or shut-of valves, floor drains, lawn sprinkler systems or fire sprinkler systems. Determine the exact flow rate, volume, pressure, temperature, or adequacy of the water supply.

Determine the water quality or potability or the reliability of the water supply or source. Open sealed plumbing access panels. Inspect clothes washing machines or their connections. Operate any main, branch or fixture valve. Test shower pans, tub and shower surrounds or enclosures for leakage. Evaluate the compliance with local or state conservation or energy standards, or the proper design or sizing of any water, waste or venting components, fixtures or piping. Determine the effectiveness of anti-siphon, back-flow prevention or drain-stop devices. Determine whether there are sufficient clean-outs for effective cleaning of drains. Evaluate gas, liquid propane or oil storage tanks. Inspect any private sewage waste disposal system or component of. Inspect water treatment systems or water filters. Inspect water storage tanks, pressure pumps or bladder tanks. Evaluate time to obtain hot water at fixtures, or perform testing of any kind to water heater elements. Evaluate or determine the adequacy of combustion air. Test, operate, open or close safety controls, manual stop valves and/or temperature or pressure relief valves. Examine ancillary systems or components, such as, but not limited to, those relating to solar water heating, hot water circulation.

5.0	PLUMBING DRAIN, WASTE AND VENT SYSTEMS	Х		
5.1	PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES	Х		\Box
5.2	HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS	Х		\Box
5.3	MAIN WATER SHUT-OFF DEVICE (Describe location)	Х		
5.4	FUEL STORAGE AND DISTRIBUTION SYSTEMS (Interior fuel storage, piping, venting, supports, leaks)		Х	
5.5	MAIN FUEL SHUT OFF (Describe Location)		Х	
5.6	SUMP PUMP		Х	

IN NI NP RR

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

IN NI NP RR Styles & Materials

Public

Water Filters:

Water Source:

None

Plumbing Water Supply (into

home):

PVC

Plumbing Water Distribution

(inside home):

PEX

Washer Drain Size:

2" Diameter

Plumbing Waste:

ABS

Water Heater Power Source:

Gas (quick recovery)

Water Heater Capacity:

50 Gallon (2-3 people)

Manufacturer:

BRADFORD-WHITE

Comments:

5.3 Shutoff is located in Northwest corner of property

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 22 of 33

6. Electrical System

The inspector shall inspect: The service line. The meter box. The main disconnect. And determine the rating of the service amperage. Panels, breakers and fuses. The service grounding and bonding. A representative sampling of switches, receptacles, light fixtures, AFCI receptacles and test all GFCI receptacles and GFCI circuit breakers observed and deemed to be GFCI's during the inspection. And report the presence of solid conductor aluminum branch circuit wiring if readily visible. And report on any GFCI-tested receptacles in which power is not present, polarity is incorrect, the receptacle is not grounded, is not secured to the wall, the cover is not in place, the ground fault circuit interrupter devices are not properly installed or do not operate properly, or evidence of arcing or excessive heat is present. The service entrance conductors and the condition of their sheathing. The ground fault circuit interrupters observed and deemed to be GFCI's during the inspection with a GFCI tester. And describe the amperage rating of the service. And report the absence of smoke detectors. Service entrance cables and report as in need of repair deficiencies in the integrity of the insulation, drip loop, or separation of conductors at weatherheads and clearances.

The inspector is not required to: Insert any tool, probe or device into the main panel, sub-panels, downstream panel, or electrical fixtures. Operate electrical systems that are shut down. Remove panel covers or dead front covers if not readily accessible. Operate over current protection devices. Operate non-accessible smoke detectors. Measure or determine the amperage or voltage of the main service if not visibly labeled. Inspect the alarm system and components. Inspect the ancillary wiring or remote control devices. Activate any electrical systems or branch circuits which are not energized. Operate overload devices. Inspect low voltage systems, electrical de-icing tapes, swimming pool wiring or any time-controlled devices. Verify the continuity of the connected service ground. Inspect private or emergency electrical supply sources, including but not limited to generators, windmills, photovoltaic solar collectors, or battery or electrical storage facility. Inspect spark or lightning arrestors. Conduct voltage drop calculations. Determine the accuracy of breaker labeling.

6.0 SERVICE ENTRANCE LINES Below ground 6.1 METER BOX, MAIN DISCONNECT, SERVICE GROUNDING/BONDING and MAIN Χ Panel capacity: and DISTRIBUTION PANELS 200 AMP 6.2 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND X **Panel Type:** COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE Circuit breakers 6.3 SWITCHES, RECEPTACLES, LIGHT FIXTURES AND VISIBLE WIRING (observed) from a representative number) Copper 6.4 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF Х Wiring Methods: INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, Not Visible CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE 6.5 OPERATION OF GFCI or AFCI (GROUND/ARC FAULT CIRCUIT X INTERRUPTERS) 6.6 LOCATION OF MAIN AND DISTRIBUTION PANELS SMOKE DETECTORS 6.7 CARBON MONOXIDE DETECTORS

IN NI NP RR Styles & Materials

Electrical Service Conductors:

Branch wire 15 and 20 AMP:

IN NI NP RR

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 23 of 33

IN NI NP RR Styles & Materials

7. Fireplace

The inspector shall inspect: The fireplace, and open and close the damper door if readily accessible and operable. Hearth extensions and other permanently installed components. And report as in need of repair deficiencies in the lintel, hearth and material surrounding the fireplace, including clearance from combustible materials.

The inspector is not required to: Inspect the flue or vent system. Inspect the interior of chimneys or flues, fire doors or screens, seals or gaskets, or mantels. Determine the need for a chimney sweep. Operate gas fireplace inserts. Light pilot flames. Determine the appropriateness of such installation. Inspect automatic fuel feed devices. Inspect combustion and/or make-up air devices. Inspect heat distribution assists whether gravity controlled or fan assisted. Ignite or extinguish fires. Determine draft characteristics. Move fireplace inserts, stoves, or firebox contents. Determine adequacy of draft, perform a smoke test or dismantle or remove any component. Perform an NFPA inspection.

		1114	141	141	1111	ory roo or maror rand
7.	.0 CHIMNEYS, FLUES AND VENTS (for fireplaces, gas water heaters or heat systems)	Х				Types of Fireplaces: Gas/LP Log starter
7.	.1 SOLID FUEL HEATING DEVICES (Fireplaces, Woodstove)			Х		Operable Fireplaces: One
7.	.2 GAS/LP FIRELOGS AND FIREPLACES	Х				Number of Woodstoves:
					RR	None

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

Comments:

7.0 The installed gas water heater has items around its vent openings. This may restrict air flow. This is for your information.



7.0 Picture 1

The Fireplace system of this home was inspected and reported on with the above information but it is incomplete. The liner or the safety aspect of the liner was not inspected. The inspection is not meant to be technically exhaustive and does not substitute an inspection by a certified chimney sweep. The inspection does not determine the safety of the fireplace in terms of the condition of liner or the absence of a liner. Any comments made by the inspector does not remove the need for an inspection by a certified chimney sweep. Chimneys should be inspected at least annually. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that a certified chimney sweep inspect the liner for safe operation.

123 Fernley Ct Page 24 of 33

8. Doors, Windows and Interior

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

The inspector shall: Open and close a representative number of doors and windows. Inspect the walls, ceilings, steps, stairways, and railings. Inspect garage doors and garage door openers by operating first by remote (if available) and then by the installed automatic door control. And report as in need of repair any installed electronic sensors that are not operable or not installed at proper heights above the garage door. And report as in need of repair any door locks or side ropes that have not been removed or disabled when garage door opener is in use. And report as in need of repair any windows that are obviously fogged or display other evidence of broken seals.

The inspector is not required to: Inspect paint, wallpaper, window treatments or finish treatments. Inspect central vacuum systems. Inspect safety glazing. Inspect security systems or components. Evaluate the fastening of countertops, cabinets, sink tops and fixtures, or firewall compromises. Move furniture, stored items, or any coverings like carpets or rugs in order to inspect the concealed floor structure. Move drop ceiling tiles. Inspect or move any household appliances. Inspect or operate equipment housed in the garage except as otherwise noted. Verify or certify safe operation of any auto reverse or related safety function of a garage door. Operate or evaluate security bar release and opening mechanisms, whether interior or exterior, including compliance with local, state, or federal standards. Operate any system, appliance or component that requires the use of special keys, codes, combinations, or devices. Operate or evaluate self-cleaning oven cycles, tilt guards/latches or signal lights. Inspect microwave ovens or test leakage from microwave ovens. Operate or examine any sauna, steam-jenny, kiln, toaster, ice-maker, coffee-maker, can-opener, bread-warmer, blender, instant hot water dispenser, or other small, ancillary devices. Inspect elevators. Inspect remote controls. Inspect appliances. Inspect items not permanently installed. Examine or operate any above-ground, movable, freestanding, or otherwise non-permanently installed pool/spa, recreational equipment or self-contained equipment. Come into contact with any pool or spa water in order to determine the system structure or components. Determine the adequacy of spa jet water force or bubble effect. Determine the structural integrity or leakage of a pool or spa.

8.0	CEILINGS	>			Ceiling Materials:
8 1	WALLS)	1		Drywall
H		一,	+	+++	Sheetrock
8.2	FLOORS	- -	+	+	Wall Material:
8.3	STEPS, STAIRWAYS, BALCONIES AND RAILINGS)	4	Ш	Drywall
8.4	COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS	>			Sheetrock
8.5	DOORS (REPRESENTATIVE NUMBER)	>			Floor Covering(s):
8.6	WINDOWS (REPRESENTATIVE NUMBER)	>	(Carpet Linoleum
		II	N N	I NP RR	Tile

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

Interior Doors:

Hollow core

IN NI NP RR Styles & Materials

Window Types:

Thermal/Insulated

Window Manufacturer:

UNKNOWN

Cabinetry:

Wood

Countertop:

Tile

Comments:

123 Fernley Ct Page 25 of 33

8.6 One window has deteriorated sealant in the Guest Bedroom. This is a maintenance issue and is for your information. I recommend prep prime and paint as needed.



8.6 Picture 1

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 26 of 33

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

9. Insulation and Ventilation

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

9.0	INSULATION IN ATTIC	Χ			
9.1	VENTILATION OF ATTIC AND FOUNDATION AREAS	Х			
9.2	VENTING SYSTEMS (Kitchens, baths and laundry)			Х	
9.3	VENTILATION FANS AND THERMOSTATIC CONTROLS (ATTIC)	Χ			

IN NI NP RR

IN NI NP RR Styles & Materials

Attic Insulation:

Blown

Ventilation:

Gable vents

Soffit Vents

Passive

Exhaust Fans:

Fan only

Dryer Power Source:


Gas Connection

Dryer Vent:

Flexible Metal

Comments:

9.2 (1) Dryer vent has gotten collapsed on the back side of dryer due to it being pushed back.

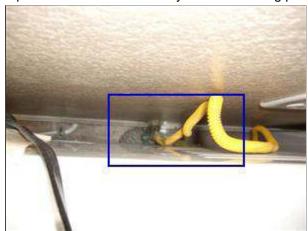

9.2 Picture 1

123 Fernley Ct Page 27 of 33

(2) Dryer vent on the outside of the home has build up of lint. This is a safety issue as a potential for fire exists if the dryer cannot vent properly.



9.2 Picture 2

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Fernley Ct Page 28 of 33

10. Garage

		1114	141	INF	NN
10.0	GARAGE CEILINGS	Χ			
10.1	GARAGE WALLS (INCLUDING FIREWALL SEPARATION)	Х			
10.2	GARAGE FLOOR	Х			
10.3	GARAGE DOOR (S)	Х			
10.4	OCCUPANT DOOR FROM GARAGE TO INSIDE HOME	Х			
10.5	GARAGE DOOR OPERATORS (Report whether or not doors will reverse when	Х			
	met with resistance)				

IN NI NP RR Styles & Materials

Garage Door Type:

One automatic

Garage Door Material:

Metal

Auto-opener Manufacturer:

CHAMBERLAIN

IN NI NP RR

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

123 Fernley Ct Page 29 of 33

11. Built-In Kitchen Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

		IN NI NP RR				Styles & Materials
11.0	DISHWASHER	Х				Dishwasher Brand: GENERAL ELECTRIC
11.1	RANGES/OVENS/COOKTOPS	Х				Disposer Brand:
11.2	RANGE HOOD	Х				BADGER
11.3	TRASH COMPACTOR			Х		Exhaust/Range hood:
11.4	FOOD WASTE DISPOSER	Х				GENERAL ELECTRIC
11.5	MICROWAVE COOKING EQUIPMENT	Х				Range/Oven:

IN NI NP RR

GENERAL ELECTRIC

Built in Microwave:

GENERAL ELECTRIC

Trash Compactors:

NONE

IN=Inspected, NI=Not Inspected, NP=Not Present, RR=Repair or Replace

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Prepared Using HomeGauge http://www.homegauge.com SHGI (c) 2000-2007 : Licensed To Home Inspection Associates, LLC

123 Fernley Ct Page 30 of 33



"Buying a home is your business...inspecting it is ours"

Home Inspection Associates, LLC

3009 Beaverhead Ln Fernley, NV 89408 (775)247-8799

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments

Pre-inspection agreement

123 Fernley Ct Page 31 of 33



Home Inspection Associates, LLC 3009 Beaverhead Ln Fernley, NV 89408 (775)247-8799

Inspected By: Robert A. Parmenter III

Inspection Date: 3/7/2008

Report ID: 0202

Customer Info:	Inspection Property:
Mrs. Home Owner	123 Fernley Ct
Mr. Home Owner	Fernley, NV 89408
123 Fernley Ct	
Fernley NV 89408	
Customer's Real Estate Professional:	

Inspection Fee:

Service	Price	Amount	Sub-Total
Heated Sq Ft 1,000 - 2,000	300.00	1	300.00

Tax \$0.00

Total Price \$300.00

Payment Method: Check

Payment Status:

Note:

123 Fernley Ct Page 32 of 33

Owner

123 Fernley Ct Page 33 of 33